


HANDHELD DIGITAL MANOMETER

Precise Air Pressure Measurement, $\pm 0.1\%$ Accuracy



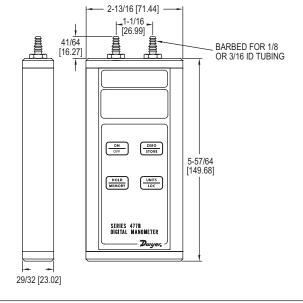

The Series 477B Handheld Digital Manometer is a versatile, hand-held, battery operated manometer available in several basic ranges from 0-20 in w.c. up to 100 psi. All models measure either positive, negative or differential pressures with ±0.10% of full-scale accuracy. You can select from up to seven common English and metric pressure units so conversions are not necessary. A memory function allows storage of up to 40 readings for later recall and a backlight provides auxiliary lighting for hard-to-see locations. Also standard are a hold feature plus both visual and audible overpressure alarms

FEATURES/BENEFITS

- Precise 0.1% FS accuracy provides four times better accuracy than most standard manometer/gages
- · Aluminum housing protects instrument against damage
- · 40 readings in internal memory reduces time to record data

APPLICATIONS

- · Lab calibration of other pressure instruments
- · Air velocity/air flow measurements in commercial buildings

SPECIFICATIONS

Service: Air and compatible gases.

Wetted Parts: Consult factory.

Accuracy: ±0.10% FS from 60 to 78°F (15.6 to 25.6°C); ±1% FS from 32 to 60 and

78 to 104°F (0 to 15 .6 and 25.6 to 40°C). Pressure Hysteresis: ±0.1% FS.

Pressure Limits: See chart.

Temperature Limits: 0 to 140°F (-17.8 to 60°C). Storage Temperature Limits: -4 to 176°F (-20 to 80°C).

Display: 4-digit LCD (.425" H x .234" W digits).

Resolution: See chart.

Power Requirements: 9 volt alkaline battery. Battery included but not connected. Connections: Two barbed connections for use with 1/8" (3.18 mm) or 3/16"

(4.76 mm) I.D. tubing for 477B-1, 477B-2, 477B-3, 477B-4 and 477B-5 only. Two compression fittings for use with 1/8" (3.18 mm) I.D. x 1/4" (6.35 mm) O.D. tubing

for 477B-6 and 477B-7 only. Weight: 10.2 oz. (289 g). Agency Approvals: CE

| MODEL CHART | | | | | | | | | | | | |
|-------------|--------------------|--------|--------------------------|-------|-------|---------|-------|-------|---------|---------|---------|----------|
| | | Availa | Available Pressure Units | | | | | | | | Maximum | |
| Model | Range | bar | psi | in Hg | kPa | in w.c. | mm Hg | mbar | ft w.c. | mm w.c. | Pa | Pressure |
| 477B-1 | 0 to 20.00 in w.c. | .0498 | .7225 | 1.471 | 4.982 | 20.00 | 37.36 | 49.82 | 1.667 | 508.0 | 4982 | 3 psig |
| 477B-2 | 0 to 40.00 in w.c. | .0996 | 1.445 | 2.942 | 9.96 | 40.00 | 74.73 | 99.6 | 3.333 | 1016 | 9964 | 3 psig |
| 477B-3 | 0 to 200.0 in w.c. | .4982 | 7.225 | 14.71 | 49.82 | 200.0 | 373.6 | 498.2 | 16.67 | 5080 | - | 15 psig |
| 477B-4 | 0 to 10.00 psi | .6895 | 10.00 | 20.36 | 68.95 | 276.8 | 517.1 | 689.5 | 23.07 | 7031 | - | 30 psig |
| 477B-5 | 0 to 30.00 psi | 2.069 | 30.00 | 61.08 | 206.9 | 830.4 | 1551 | 2069 | 69.20 | - | - | 60 psig |
| 477B-6 | 0 to 50.00 psi | 3.447 | 50.00 | 101.8 | 344.7 | 1384 | 2585 | 3447 | 115.3 | - | - | 100 psig |
| 477B-7 | 0 to 100.0 psi | 6.895 | 100.0 | 203.6 | 689.5 | 2768 | 5171 | 6895 | 230.7 | - | - | 200 psig |

| OPTIONS | | | | | | | |
|----------------------|--|--|--|--|--|--|--|
| To order add suffix: | Description | | | | | | |
| -NIST | NIST traceable calibration certificate | | | | | | |
| Example: 477B-1-NIST | | | | | | | |

| ACCESSORIES | | | | | | |
|--|--|--|--|--|--|--|
| Description | | | | | | |
| 402A Carrying case; tough gray nylon pouch protects any Series 477B | | | | | | |
| Manometer; double zippered for quick and easy access, with a belt loop | | | | | | |
| that snaps closed; 7-1/2"H x 3"W x 2-1/4"D (191 x 76 x 57 mm) | | | | | | |
| Soft carrying case | | | | | | |
| Protective magnetic rubber boot | | | | | | |
| | | | | | | |







UHH-C1 A-47X-BOOT (manometer not included)